
| LIBER 1809 | ##325 |
|------------|-------|
|------------|-------|

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

| | i ining itoqu | II O III O I I I I I I | 7 | (2) | | |
|---|---------------------------|------------------------|-------------------|------------------------|---------|------------|
| For corners in Muskegon County | Located in: | Corner Code # | SUPPLY A | Final Action | | - 1 S |
| Public Land Survey | T <u>11N</u> R <u>17W</u> | G-5 | MONULATION | 의 (1 위 (1 된) | 2 | |
| , | TR TR | | APR 2 8 1995 | 23 A | ų. Ų | |
| 2. Property Controlling S_ | TR | | COMMISSION | \(\frac{1}{2}\) | 9 | : 13 23 |
| in Section S_ 3. Miscellaneous S_ Property in Sec. S_ | _ t | | Register of Deeds | Stamp & I | ⁼ile Nu | mber |
| 4. Lot No,Recorded F | Plat | | ABCDE | FGH | JK | LM |
| 5. Private Claims | , | | 2 6 5 | 4 3 | - 2 - | - - |

Donald G. Sandel __,in a field survey on Nov. 11, 1994 hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

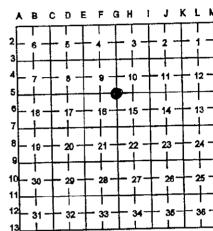

- A. Description of original monument and accessories and/or subsequent restoration:
 - (1) GLO: To Beech, 6" corner sections 9, 10, 15, 16 on July 2, 1837. Witness: Maple 20" N41°E 0.18 chains.
 - (2) MCRC (1950's); rail road spike; witnesses: NW 79.25' (UNK OBJ.), SW 42.08' Black Gum.
 - (3) Found 1 1/2" pipe ±3' North of center line "X" as recorded by Francis Smith (A-118) on October 16, 1980; witnesses: N50°E center line 2" Spruce 54.2'; S 42°E center line Telephone Box 53.8', S15°E set nail W side 10" W Pine 97.32', N46°W set nail NE sidePower Pole 78.44'.
 - (4) Corner destroyed in the construction of road. Set monument box with 1/2" rod, as recorded by John Lazarock on Jan. 10, 1990, Liber 1503, Page 600. Witnesses: N36°W 78.47' Power Pole, N20°E 162.86' 16" Maple, N38°E 88.17' 4" Spruce, S10°E 97.25' 10" Pine.
- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
 - (1) Found 1/2" rod in 1 1/2" well point pipe in county monument box (w/cover) ±3' N of center line Michillinda Road and at approximate center line of Simonelli Road. Verified corner location using existing PK's in asphalt and witness in NW Quadrant.
 - (2) Historical usage, documentation, and evidence of corner location reviewed and ratified by the Muskegon County Peer Group, April 5, 1994.
- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 2 3/4" D Cast Iron "County Survey" monument in place of found 1/2" road and well point; witnessed as follows:

N46°W, found nail NE side, Power Pole, 78.44' N44°W, set nail SW side, Light Pole, 46.60' N30°E, set N. end of curb, back of curb, 46.80' S23°E, set nail W side, W. Pine, 69.90' S14°E, set nail NE side, W. Pine, 86.86' S65°W, set W. end of curb, back of curb, 50.05

POSITION OF SAID RECORDED CORNER REVIEWED & RATIFIED BY MUSKESON COUNTY PEER GROUP IN ACCORDANCE With P.A. 345, OF 1990

Signed by_ GOFESSION ...

Surveyor's Michigan License No.

25870