

SURVEY & REMONUMENTATION

MAY 22 1997

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

MARQUETTE COUNTY
MICHIGAN
RECEIVED FOR RECORD

1996 DEC 20 PM 2:12

Patricia A. Monks
REGISTER OF DEEDS
P.M.W.

For corners in
MARQUETTE
(County)

Located In:

Corner Code #

1. Public Land Survey	T <u>48N</u> R <u>26W</u>	<u>G-12</u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
2. Property Controlling in Section	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
3. Miscellaneous	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
Property in Sec.	S <u> </u> T <u> </u> R <u> </u>	<u> </u>

LIBER

1 PAGE 357

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat

5. Private Claims

I, GERALD W. CARLSON, in a field survey on OCTOBER 17TH, 19 96, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

G-12: Quarter Corner common to Sections 33 and 34.

1845: Sam U. Hill's original subdivision survey notes describe the corner monument as a wood post referenced by:

10" Y. Birch N40W, 37 L 14" Cedar S38E, 12 L

No Date: The corner is shown on a field map of Section 33 by R.A. Brotherton for C.C.I.

Co.. Distance West, 2630' to the Center 1/4 Corner of Section 33; Distance North, 2642.5' to the N.E. Corner of Section 33. No accessories given.

No Date: The corner is shown as an Iron Pipe on a sketch of Section 33 by R.A. Brotherton. Distance West, 2630' to the Center 1/4 Corner of Section 33. No accessories given.

No Date: The corner is shown as an Iron Pipe on a sketch of Section 34 by R.A. Brotherton. Distance North, 2642.5' to the N.W. Corner of Section 34. No accessories given.

1940: Survey notes from the MCRC F.B. #601, indicates that they tied into a point believed to be near the corner location. The point tied into was 5' West of a squared Cedar stub. Found very old blazes on this Cedar which is about 10' East of an old squared Spruce. Many old cruiser's names on the Cedar. Did not find any Iron Pin or Post at this time.

No Date: An index book (no page given) from the MCRC indicates the corner as a 1 1/4" Iron Pipe. No accessories given.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

3-12: 1996: No original evidence found. Found and accepted a 1 3/4" I.D. Iron Pipe, 0.5' above ground in marsh land / bog with standing water. One foot of the pipe appears to be broken off. Corner is +/- 200' South of L.S. & I Railroad. Checked Line Call: South, 2.0 Chains (132'), Leave Tamarack Swamp. Measured Call: South, 130', Leave Swamp - call fits well. Distance North is 2639.39' and Distance South is 2687.94'.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

i-12: 1996: Set, over top of existing length of pipe, a 2 3/8" O.D. aluminum pipe capped with a 3 1/4" diameter aluminum tablet Marquette County Survey Monument stamped to identify the corner. Monument is 0.5' above ground.

Found reference:

0" Ash (Dead) S47W, 9.75' to C/L (Has old blazes, flagging, and paint)

Established references:

3" Ash S66E, 11.07'


3" Balsam S55W, 13.20'

Green Steel Sign Post w/ Yellow Survey Marker Sign

Note: Bearing trees have painted face, butt, and side nail blazes,

h. measuring nails, and stamped B.T. Tags affixed. Bk. 9, Pg. 101.

4" Balsam S07W, 13.76'
9" Ash N26E, 16.71'
S02E, 2.0'

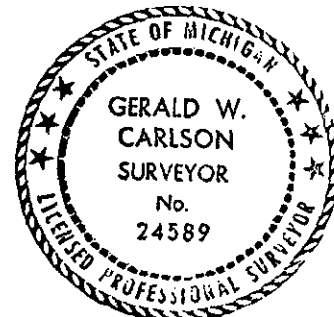

Signed by Gerald W. Carlson

Date 12-19-96

Surveyor's Michigan License No. 24589

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971

REVISED MAY 14, 1975

REVISED JAN., 1983

REVISED OCT., 1995