

SURVEY & REMONUMENTATION

JAN 09 2001

SECTION

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

Approved by Menominee County
Land Survey Remonumentation
Peer Group Under Act 345 of
P.A. of 1990 On 12/02, 2000
Mike Davis RLS
Chairman

For corners in
MENOMINEE

(County)

Located In:

Corner Code #

1. Public Land Survey

T 38N R 26W B-07

2. Property Controlling
in Section

S T R

3. Miscellaneous
Property in Sec.

S T R

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

I, William Lenca, in a field survey on Sep. 05, 1900 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1852: Original Survey by George Adair - B.T.'s - Hemlock, 13" - N44°E - 27 lks; Cedar, 14" - S68°W - 14 lks. All original evidence for this corner has been destroyed by County Road improvements.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

We found no original evidence or subsequent restoration for this corner position. We therefore re-established the corner in the centerline of County Roads running East - West and in line with ancient fences running North and South. This position fits well with measurements to Section Corners 1/2 mile East and 1/2 mile West, and is accepted as the best available evidence of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 5/8" x 24" Iron Rod/3-1/4" dia. Alum. cap stamped for corner location in Monument Box:

6" dia. Tamarack

5/8" x 24" Iron Rod/2" dia. Alum. cap marked "WITNESS MARKER"

9" dia. Tamarack

6" dia. Tamarack

Metal Survey Sign Post

N04°E

50.74 feet

Scr. NBT

South

34.22 feet

@ Survey Sign Post

S56°W

86.61 feet

Scr. NBT

N70°W

104.39 feet

Scr. NBT

South

34.9 feet


NOTE: All bearings are magnetic bearings. All distances are measured with steel tape. Distances to trees are to nail in side of tree.

Signed by William Lenca

Date Sept. 8, 2000

Surveyor's Michigan License No. 26461

Bk. 6 Pg. 200

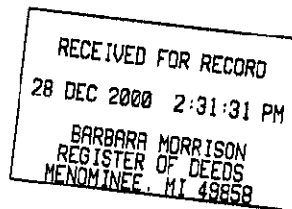

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

