

SURVEY & REMONUMENTATION

#938

DEC 07 1994

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

LIBER 390 PAGE 15

For corners in
MISSAUKEE
(County)

Located In:

Corner Code ##

MISSAUKEE COUNTY MICHIGAN

RECORDED OCT 28 1994 1:15 P.M.

Carolyn Flare
REGISTER

Register of Deeds Stamp & File Number

- | | | |
|------------------------------------|------------|-----|
| 1. Public Land Survey | T 24N R 7W | B-9 |
| | T R | |
| | T R | |
| | T R | |
| 2. Property Controlling in Section | S T R | |
| | S T R | |
| 3. Miscellaneous Property in Sec. | S T R | |
| | S T R | |

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, **J. Dean Geers**, in a field survey on **July 24**, 19 **94**, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- B-9) 1852 GLO Quarter Section post by Whelpley, Deputy Surveyor
Beech 6 N 33 3/4 E 3, Beech 10 S 53 3/4 W 18
- B-9) 1909 Cavanagh, County Surveyor: Gas pipe in concrete
Bass 6 S 67 E 95, Elm 10 S 55 1/2 E 118, Poplar 2 S 72 W 103
- B-9) 1967 MDOT, Liber 1, page 303: Found 1" pipe in concrete monument
- B-9) 1980 Wilcox, S-2, page 49, S-2, page 54: Found 1" pipe in monument box as recorded in Liber 1, page 303
- B-9) 1983 Wilcox, S-2, page 168: Found 1" pipe in monument box as recorded in Liber 1, page 303

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

B-9) Quarter corner common to Sections 19 and 30

Found 1" pipe in monument box as recorded in Liber 1, page 303. This corner is accepted as a careful and faithful perpetuation of the position of the original corner. Corner is $\pm 0.5'$ South of East-West road Centerline.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


B-9) Found 1" pipe and raised with 1/2" Iron and Missaukee County monument in monument box

- S 40 E - 54.41 - 8" Elm
- S 50 W - 44.32 - 6" Scotch Pine
- S 10 W - 30.35 - 6" Scotch Pine
- N 39 E - 54.79 - Pole @ telephone riser

Peer Group Reviewed and Approved

Date: 10-26-94

J. Dean Geers, Missaukee Co. Representative

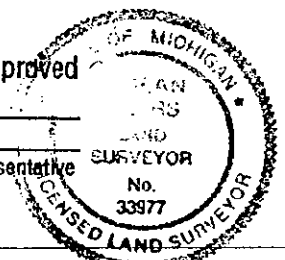

Signed by *J. Dean Geers*

Date 9/28/94

Surveyor's Michigan License No. 33977