

FEB 08 2000

Montmorency County Remonumentation Liber 00012 Page 0371

## SECTION

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

MONTMORENCY

(County)

BRILEY TWP.

Located In:

Corner Code #

1. Public Land Survey

T30N, R 2E

J - 1

T R

T R

T R

2. Property Controlling  
in Section

S T R

S T R

3. Miscellaneous  
Property in Sec.

S T R

S T R

STATE OF MICHIGAN  
MONTMORENCY COUNTY  
Recorded & Filed

11-12-1999 09:26:17

TERESA WALKER  
REGISTER OF DEEDS  
Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat

5. Private Claims

	A	B	C	D	E	F	G	H	I	J	K	L
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

I, DONALD E MARLATT, in a field survey on JULY, 19 99

do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

## A. Description of original monument and accessories and/or subsequent restoration:

J - 1 NORTH 1/4 CORNER OF SEC. 2.

NO GLO CORNER SET ON ORIGINAL SURVEY.

G.F. DELAMATER PS#693 NOTES-NO DATE. FD. WELL POINT. B. OAK 12" N24°E 85.6', POINTED STONE S24°W 71.2'

N.C. CALDWELL PS#12018 NOTES. JUNE 1973. FD. 1/2"BAR IN CENTERLINE OF M-33.

D.E. PORTER PS#15410 ACT 132. JUNE 15, 1977. L. 2, P. 335. FD. 1/2"IRON. N23°E 86.1' 14"OAK, S53°E 66.8' 15"POPLAR.

D.E. MARLATT PS#18660 ACT 132, 10-27-78, L. 2, P. 498. FD. 1/2"ROD. N23°E 86.1' 14"OAK, S53°E 66.8' 15"POPLAR.

D.E. MARLATT ACT 132, 11-29-84. L. 3, P. 274. FD. 1/2" ROD. (WIT. SAME AS ABOVE).

L. BEAUREGARD PS#18654. ACT 132, 10-9-1990. L. 3, P. 560. FD. 1/2"BAR. N23°E 16"OAK 86.1', S53°E 18"POLAR 66.8', EAST R/W MARKER 100'.

D.E. MARLATT ACT 132 DATED 11-17-92. FD. 1/2"ROD IN MONUMENT BOX. N23°E 86.1' 14"OAK, S53°E 66.8' 15"POPLAR. (NOT RECORDED)

D.E. MARLATT ACT 132 DATED 10-11-94. FD. BOAT SPIKE. S73°E 56.32' 17"J. PINE, N83°E 69.45' 14"N. PINE, N54°E 72.9' 14"N. PINE, N58°W 90.75' 11"N. PINE. 1.5' WEST OF C/L OF M-32. L. 10004, P. 2

D.E. MARLATT ACT 132 DATED 7-17-96. FD. BOAT SPIKE IN MON. BOX (WIT. SAME AS ABOVE). (NOT RECORDED)

D.E. MARLATT ACT 132 DATED 12-13-97 FD. IRON IN MON. BOX (WIT. SAME AS ABOVE). NOT RECORDED.

## B. Description of cor. evidence fd. and/or method applied in restoring or reestablishing corner.

J - 1 NORTH 1/4 CORNER OF SEC. 2. FD. 1/2"ROD IN MON. BOX. 1.5' WEST OF C/L OF M-33.

S73°E 56.32' 17"J. PINE R. S45°E CONC. MON. LYING DOWN 50' M OR L.

N83°E 69.45' 14"N. PINE R. S45°W I &amp; C #12018 50'

N54°E 72.9' 14"N. PINE R.

N58°W 90.75' 11"N. PINE R.

## C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

J - 1 NORTH 1/4 CORNER OF SEC. 2

PLACE REMON. CAP ON 1/2"ROD IN MONUMENT BOX.

N56°W 10"N. PINE 90.7'

S72°E 19"N. PINE 56.35'

N87°E 17"N. PINE 69.5'

N56°E 17"N. PINE 72.85'


WITNESSES MARKED WITH 40 PENNY SPIKES WITH PS TAG# 18660.

APPROVED BY PEER GROUP JULY 20, 1999 AS A CAREFUL AND FAITHFUL ESTABLISHMENT OF THE POSITION OF THE CORNER.

APPROVED BY  
PEER GROUP

JUL 20 99

L.H.B.

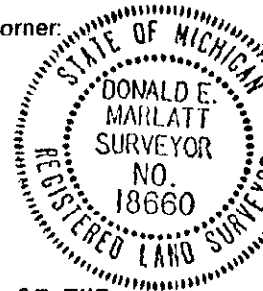

Signed by

Donald E. Marlatt

Date

11-8-99

Surveyor's Michigan License No. 19660