

FEB 08 2000

Montmorency County Remonumentation

Liber 00012 Page 0363

SECTION

For corners in

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

MONTMORENCY
(County)

Located In:

Corner Code #

BRILEY TWP.
1. Public Land Survey

T	30N	R	2E	K - 1
T		R		
T		R		
T		R		
T		R		
S		T		
S		T		
S		T		
S		T		

STATE OF MICHIGAN
MONTMORENCY COUNTY
Recorded & Filed

11-12-1999 09:27:27

TERESA WALKER
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

I, DONALD E MARLATT, in a field survey on JULY, 19 99 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

K - 1 NORTH CORNER COMMON TO SEC.S 1 & 2.
GLO CORNER SET BY LEWIS CLASON IN APRIL 1840. W. PINE 6" S33°W 17 L., Y. PINE 5" S54°E 11 L.
F. SMITH PS#754 NOTES. JUNE 13, 1947. NBT NORWAY 10" S41°45'W 71.9', NBT OAK 5" N66°15'E 45.4'
D.E. PORTER PS#15410 ACT 132 DATED 2-27-1975. L. 2, P. 70. FD. 3"SQ STK & POINTED STONE IN FENCE LINE. SET 1/2"ROD & CAP. N65°W 11.76' 10"OAK, N80°E 16.19' 7"OAK, S28°E 16.09' 8"OAK.
D.E. PORTER ACT 74 DATED 3-16-75. L. 1, PAGE 141, FD. 3"SQ STK AND POINTED STONE IN FE. WIRE N & S. WIRE TO EAST 50'NORTH. SET 1/2 ROD & CAP. (WIT. SAME AS ABOVE).
D.E. PORTER ACT 132 DATED 6-15-77. L. 2, P. 335. FD. 3"SQ. STK & 12"ROD (WIT. SAME AS ABOVE).
D.E. MARLATT PS#18660 ACT 132 DATED 6-6-87. FD. 1/2"ROD & CAP#15410 (WIT. SAME AS ABOVE). NOT REC
D.E. MARLATT ACT 132 DATED 11-17-92. FD. 1/2"ROD & CAP (WIT. SAME AS ABOVE). NOT RECORDED.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

K- 1 NORTH CORNER COMMON TO SEC.S 1 & 2.

FOUND 1/2"ROD & POINTED STONE

N80°E 16.19' 11"OAK R.

S28°E 16.09' 12"OAK R.

APPROVED BY
PEER GROUP

JUL 20 99

P.A.B

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K - 1 NORTH CORNER COMMON TO SEC.S 1 & 2.

SET CONC. MONUMENT AND REMON. CAP

N85°E 11"OAK 16.26'


S30°E 12"OAK 16.05'

S59°W 14"OAK 27.9'

N70°W 12"OAK 21.32'

WITNESSES MARKED WITH 40 PENNY SPIKES AND PS TAG#18660.

APPROVED BY PEER GROUP JULY 20, 1999 AS THE BEST AVAILABLE EVIDENCE OF THE POSITION OF THE ORIGINAL CORNER.

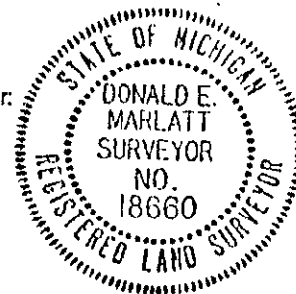

Signed by Donald E Marlatt
Surveyor's Michigan License No. 18660

Date 11-8-99