LAND CORNER RECORDATION CERTIFICATE


Filing Requirement of Act 74, Mich. PA 1970

For Corners In: OGEMAW	Located In			Corner Code #	
(County)					
Public Land Survey		T T	22N 22N	R 3E R 3E	G-2 G-3
Property Controlling in Section	s	Т		R	
Miscellaneous Property in Section	s	Т		. R	
	S	Т		R	
	s	Т		R	
4. Lot No:	Recorded Plat:				
5. Private Claims:					

Register of Deeds Stamp & File Number

I, <u>Carl T. Kiiskila</u>, in a field survey on <u>March 15, 2012</u> do hereby state that under requirements of PA 74, Michigan PA of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

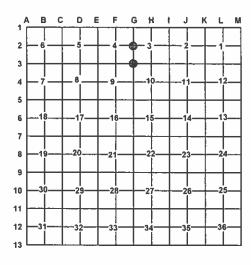

- A. Description of original monument and accessories and/or subsequent restoration:
- G-2 1/4 corner common to Sections 3&4, T22N,R03E
 - 1846 GLO B.F. Hall set quarter section post Beech 8 N58W 11 lks Cedar 12 S12E 24 lks
 - 1960 James E. Richardson RLS #2527 set 1/2" bar by single proportionate measurement.
 - 1990's James H. Granger P.S.#16041 used Richardson's bar for work in section 4.
- G-3 Section corner common to sections 3,4,9&10, T22N,R03E
 - 1846 GLO B.F. Hall set post corner sections 3,4,9&10 Fir 10 N15 E 17 lks Cedar 14 S69W 15 lks
 - 1960 James E. Richardson RLS #2527 set 1/2" bar by single proportionate measurement between the ¼ corner to the South and township line to the North.
- B. Description of corner evidence found and/or method applies in restoring or re-establishing corner:
- G-2 1/4 corner common to Sections 3&4, T22N,R03E

Found 1/2" rod fitting Richardson's survey in section 4, the corner falls 1' West of centerline of the North-South gravel road. Found no other evidence to dispute the location for the corner

G-3 – Section corner common to sections 3,4,9&10, T22N,R03E

Found 1/2" rod fitting Richardson's survey in section 4, the corner falls 2.5' West of centerline of the North-South gravel road. Found no other evidence to dispute the location for the corner.

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
 - G-2 1/4 corner common to Sections 3&4, T22N,R03E Drove 1"x36" pipe with PS cap# 33981 over found 1/2" bar
- G-3 Section corner common to sections 3,4,9&10, T22N,R03E Drove 1"x36" pipe with PS cap# 33981 over found ½" bar

Wit: N58°E 68.16' to set N&T SE side 14" W. Pine S55°E 30.00' to set N&T NE side 4" W. Pine S86°W 34.08 to set N&T N side 8" Balsam N26°W 61.56 to set N&T W side P. Pole North 44' to old fence going Westerly Set Blue Carsonite Post 33' West

Wit: N29°E 56.09' to fnd N&T W side P. Pote S53°E 42.92' to set N&T SW side 7" Balsam S55°W 20.38' to set N&T NW side 4" Balsam N48°W 26.73 to set N&T SW side 7" Balsam Set Blue Carsonite Post 33' West

OF MICHIGAN CARL KHSKILA

LAND JRVEYOR No.

33981 SURVEY

Signed by:

Carl T Kinkila

8-15-12

Surveyor's Michigan License No.:

33981

De # 3107416 L: 6 P: 292 /15/2012 02:07:37 PM Page: 1 of 1 RC Fee:\$ 14.00 nise Simmons, Ogemaw Co. Register