

JUDITH D. ROEHM
Ontonagon County

1P

Page 1 of 1

LC 5/341

JEM Date 10/03/2000

Time 10:36:24

RECORDING FEE:

9.00

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

ONTONAGON

(County)

Located in:

Corner Code #

SURVEY &
REMONUMENTATION

MAR 02 2001

SECTION

Register of Deeds Stamp & File Number

1. Public Land Survey

T48N R 40W

E-3

2. Property Controlling
in Section

S

T R

3. Miscellaneous
Property in Sec.

S

T R

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

Section Corner common to Sections 4, 5, 8, & 9, T48N R40W.

2000

I, Earl W. Applekamp, in a field survey on Sept. 14, 2000 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2													
3													
4													
5													
6													
7													
8													
9													
10													
11													
12													
13													

A. Description of original monument and accessories and/or subsequent restoration:

Original Corner established by Wells Burt, U.S. Deputy Surveyor, June 1851. Corner was a 16" Yellow Birch.

ORIGINAL BEARING TREE:

16" Cedar S65°W 29 Links (19.14 Feet)

DEED GROUP APPROVED
Earl W. Applekamp
COUNTY REGISTRAR
9-27-00

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


No original evidence was found. Corner falls in a County Road. At the corner position there is a occupied line running East and a delapidated fence line. A creek call North is in agreement with this position. The monumented corner 1 mile South is in agreement with the distance on the original field notes. I monumented the corner at the intersection of the road center-line and the occupied line running East.

Research on file with the Ontonagon County Remonumentation Program Representative.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

At the corner position I set a 5/8"x12" rebar with a 3" stamped cap 5" below top of a gravel road. Cap is stamped to read: County Remonumentation, T48N, R40W, S4, S5, S8, S9, 2000, P.S. 17610. I established 2 bearing trees, a reference monument, which is a 2 1/2"x30" aluminum pipe with a 3" stamped cap and a reference object.

REF. MON. S89°W 36.10' - Nail in 6" Maple N41°W 65.03'
P. Pole S06°E 180.63' - Nail in 11" Cedar N73°E 54.21'

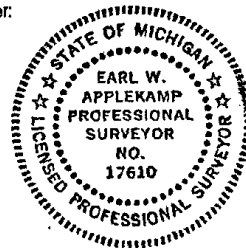

Signed by

Earl W. Applekamp

Date September 25, 2000

Surveyor's Michigan License No. _____

17610