

# SURVEY & REMONUMENTATION

RECORDED

APR 24 1995

## OTTAWA COUNTY REMONUMENTATION LAND CORNER RECORDATION CERTIFICATE

94 DEC 15 AM 11:51

Filing Requirement of Act 74, Mich. P.A. 1970

*Phyllis Robinson*  
REGISTER OF DEEDS  
OTTAWA COUNTY, MI

For corners in **COMMISSION**

<u>Ottawa</u> (County)	Located In: <u>Robinson Twp.</u>	Corner Code # _____
1. Public Land Survey	T <u>7N</u> R <u>15W</u>	<u>A-9</u>
	T _____ R _____	<u>SW Corner</u>
	T _____ R _____	<u>Section 19</u>
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

Register of Deeds Stamp & File Number

I, Carl P. Englert, in a field survey on October 19, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE:** Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration:  
A-9 corner common to Sections 19 & 30  
Original gov't corner set May, 1832  
by Calvin Britain D.S.

LCRC Liber 4, Page 315(4/12/8  
Set Cast Iron Monument  
20" Pine NNE 62.38  
20" Pine NE 95.20  
Telephone Pole NW 43.42  
26" Oak SE 89.62  
G. Haven Cor. SOUTH 21.92

West Bdry 33' N of Post & set corner to 19 & 30  
W. Oak 20" S28°E 13 Links  
W. Oak 12" N21°E 33 Links

(See Back Of Page)

- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:  
A-9 corner common to Sections 19 & 30

Found 3" Harrison Cast Iron Mon.  
Found 20" Pine NNE 62.38'  
Found 20" Pine NE 95.20'  
Found G.H. Corner South 21.9'

FILED APPROVED 12/12/94  
*Richard D. Medewell*

Accepted as a careful and faithful perpetuation of the original position of the corner.


- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:  
A-9 corner common to Sections 19 & 30

3" Harrison Cast Iron Mon. Broken, 8" deep, Set Mon. Box		
O.C. Remon. Tag & Nail in SW side P.P.	N52°W	47.36'
O.C. Remon. Tag & Nail in S. side 20" Pine	N70°E	94.99'
O.C. Remon. Tag & Nail in W. side 24" Oak	S15°E	99.38'
O.C. Remon. Tag & Nail in E. side 26" Oak	N13°E	163.93'
T7N, R16W corner	South	21.90'

Signed by Carl P. Englert  
Surveyor's Michigan License No. 18987

Date 12/11/94

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 24, 1975  
REVISED 1975

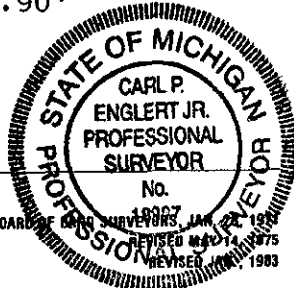

LCRC Liber 2, Page 413 (11/29/73)  
A-9 Fd. P.K. Nail  
N.W. 43.41 T.P.  
N.W. 62.38' 18" Pine  
E.N.E. 58.18' T.P.

LCRC Liber 3, Page 490 (10/22/79)  
A-9 found PK Nail  
South - Mon Box 21.8'  
in E of Blacktop Road