

SURVEY & REMONUMENTATION

APR 05 1996

COMMISSION

OTTAWA COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Ottawa

(County)

Located In:

Wright Twp.

Corner Code #

1. Public Land Survey

T 8N R 13W

H-13

T R

S. 1/4 Corner

T R

Sec 34

T R

2. Property Controlling
in Section

S

T R

S

T R

3. Miscellaneous
Property in Sec.

S

T R

S

T R

RECORDED

95 NOV 29 PM 1:46

Register of Deeds
REGISTER OF DEEDS
OTTAWA COUNTY, MI

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

I, Carl P. Englert, Jr., in a field survey on October 31, 1995 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

H-13 South 1/4 corner Section 34
Original corner Set April, 1837
by Noah Brookfield
Sugar 10" NW 26 Links
Walnut 10" NE 24 Links

LCRC Liber 3, Page 262, 3/7/1978
Set R.R. Spike by Previous Witnesses
Nail in face of T.P. E-SE 88.3'
P.K. in Wly side 18" Oak NE 59.43'
Iron W 148.9'

see other side

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

H-13 South 1/4 corner Section 34
Found 3" C.I.M. with top broken off in Mon Box
Found 24" Oak NE 59.45'
Found 17" Pine SW 43.16'
Found 16" Spruce SE 53.65'
Found Iron Stake West 148.90'

P.A. 345 OTTAWA COUNTY
PEER APPROVED 11-20-95

Kendry D. Nedewold
Y D N

Accepted as a careful and faithful perpetuation of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


H-13 South 1/4 corner Section 34
3" CIM in Mon Box 2'± N. of CL asphalt pavement
Ottawa County Remonumentation tag and nail in NW side 7" Oak N 64° W 98.09'
Ottawa County Remonumentation tag and nail in W. side 17" Pine S 14° W 43.06'
Ottawa County Remonumentation tag and nail in W. side 24" Oak N 31° E 59.31'
Ottawa County Remonumentation tag and nail in NE side 16" Spruce S 29° E 54.03'
Iron Stake West 148.90'

Signed by

Carl P. Englert Jr.

Surveyor's Michigan License No.

18987

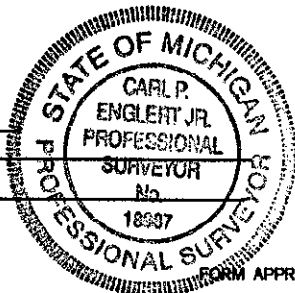

Date

11/10/1995

H-13 T8N, R13W

LCRC Liber 5, Page 103, 3-10-1983

Fd R.R. Spike 2' N of CL of Hayes Street

Sq Spike in NW side 22" Oak NE 59.42'

Top center of Fence Post @ west end of CL Fence SE 37.07'

Sq Spike in Ely side 12" Pine S-SW 43.29'

Sq. Spike in NW side 8" Pine SW 59.91'

LCRC Liber 6, Page 88, 11/1/1990

Found R.R. Spike, Set CIM

20" Oak NE 59.45'

12" Pine SW 43.16'

14" Spruce SE 53.65'

W to Tallmadge corner 148.90'

\$ 11.00 CORNER