

FEB 24 2000

OTTAWA COUNTY REMONUMENTATION

99 JUL 30 PM 12: 26

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

REGISTER OF DEEDS
OTTAWA COUNTY, MI

For corners in

Ottawa
(County)

Located In: Chester Twp
9W 13W

Corner Code #
A-8
W 1/4 Cor., Sec. 19

1. Public Land Survey
T R
T R
T R
T R

2. Property Controlling
in Section
S T R
S T R

3. Miscellaneous
Property in Sec.
S T R
S T R

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Randal D. Feenstra, in a field survey on March 15, 1999 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

G.L.O. L-5, P-145, 1984 (Joiner)
Not Set Part B: Found 1/2: Rod Part C: Set Cast Iron Monument
10" Cherry SW 44.55 8" Ash NE 34.51
Power Pole E 55.64 Power Pole E 56.16
Twin Elm NNE 82.79
Triple Elm WSW 33.73

Muskegon County Information
M-8 L-1301, P-602, 1984
(Lewandoski)

Cast Iron Monument
Power Pole E 56.10'
10" Basswood N 35°E 34.54'
4" Triple Elm S75°W 33.74'
10" Basswood S25°W 69.54'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

RA. 345 OTTAWA COUNTY


A-8 Found: Broken Cast Iron Monument in Gravel
Nail In Power Pole AZ 86°50' 56.46'
Nail In Nail in 9" Triple Elm AZ 251°50' 33.72'

PEER APPROVED 7/12/99

This position not established by original government surveyors. This location is accepted as the best available evidence of the position of the corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-8 Broken Cast Iron Monument in Gravel (See Sketch)
Set Ottawa County Remon Nail & Tag in NW side of Fence Post AZ 33°50' 101.11'
Ottawa County Remon Nail & Tag in S side of Power Pole AZ 86°50' 56.46'
Ottawa County Remon Nail & Tag in E side of 15" Maple AZ 198°45' 95.09'
Ottawa County Remon Nail & Tag in S side of 9" Triple Elm AZ 251°50' 33.72'
On Centerline N-S gravel road (48th Ave.)

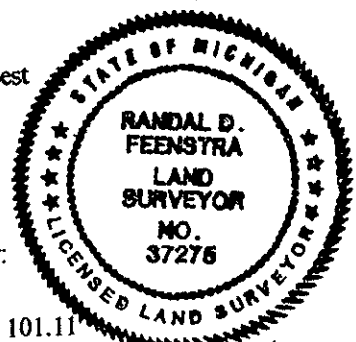

Signed by Randal D. Feenstra
Surveyor's Michigan License No. 37275

Date May 14, 1999

WILSON &
R.F. ENGINEERS

FEB 24 2000

SECTION

