

SURVEY & REMONUMENTATION

APR 29 1996

COMMISSION

JUDITH D. ROEHM
Ontonagon County
LC 4/ 4 JEM Fee: 9.00
Page 1 of 1

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Ontonagon
(County)

Located In:

Corner Code #

- | | | |
|------------------------------------|-------------|-----|
| 1. Public Land Survey | T 48N R 43W | K-6 |
| | T R | |
| | T R | |
| | T R | |
| 2. Property Controlling in Section | S T R | |
| | S T R | |
| 3. Miscellaneous | S T R | |
| Property in Section | S T R | |

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

One-quarter corner Sections 13 & 14, T48N, R43W.

I, John R. Garske, in a field survey on December 6, 1995, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

Corner set by Austin Burt, D.S., August 1848, being a cedar post from which he established:

8" Y. birch - S35°W - 25 links (16.50') 16" hemlock - N42°E - 28 links (18.48')

1942- MDOT Highway Plans show corner location 975 feet west.

1977- Survey by Earl Applekamp shows 1" drill steel at corner with B.T.'s:

5" cedar - N88°W - 4.77 feet

5" Y. birch - S25°W - 7.51 feet

5" S. maple - N58°E - 10.01 feet

1990- Survey by J. Garske, found 1" drill steel and above B.T.'s.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1" drill steel at one-quarter corner location as per Applekamp survey. This corner position has been used since 1977 in the subdivision of Section 13 for the location of properties along the west shore of Lake Gogebic. I am accepting the drill steel by its long use and acceptance through many surveys of record.

Record research on file with County Representative.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I replaced the drill steel with a 3/4" diameter x 4 foot long aluminum rod with a 3 1/4" diameter aluminum cap stamped to identify the corner. I established the following bearing trees and/or reference objects:

9" S. maple - N64°E - 5.80 feet


9" cedar - N65°W - 3.30 feet (existing)

6" Y. birch - S18°W - 6.27 feet (existing)

6" steel rail with sign - S50°E - 1.38 feet

PEER GROUP APPROVED

Earl W. Applekamp
COUNTY REPRESENTATIVE
12-14-95

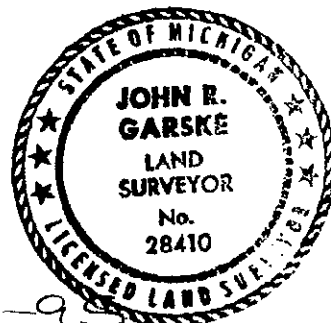

Signed by

John R. Garske

Date

12-11-95

Surveyor's Michigan License No. 28410

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983