DEC 1 6 1995

3. Miscellaneous

Property in Sec.

JUDITH D. ROEHM Ontonason County 07/11/96

09:06

LAND CORNER RECORDATION CERTIFICATE COMMISSION Filing Requirement of Act 74, Mich. P.A. 1970

4/ 119 JEM

Fee!

Page

For corners in		• • • • • • • • • • • • • • • • • • • •		
_	Ontonagon (County)	Located In:	Corner Code =##	
1.	Public Land Survey	T <u>49N</u> R <u>43</u> W T R T R T R	G=1.1	
2.	Property Controlling in Section	S T R S T R		


Register of Deeds Stamp & File Number

___, Recorded Plat __ 4. Lot No. 5. Private Claims _

Sec. Cor. 27, 28, 33 & 34; T.49 N., R.43 W.

June 17, Richard L. Drahn, in a field survey on ... do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

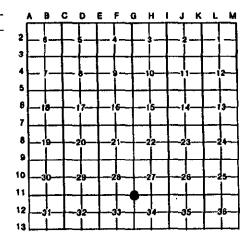

A. Description of original monument and accessories and/or subsequent restoration:

Corner established by William Burt on June 30, 1848. Original B.T.s --Sugar 8" N.55 W. 39 links (25.74') --- Sugar 10" S.55 E. 27 links (17.82')
M. Larson on 5/7/35 recovered the SE Sugar and a Y. Birch witness tree, all still scribed. Corner restored by Donald D. Lappala, RLS 12585, on 6/22/70 from the original scribed Cedar post, the remains of the two original B.T.s (one still scribed) and a live GLO witness tree with blazes. He set a $2\frac{1}{2}$ " iron pipe with a stamped, 3" brass cap and the following new B.T.s:---6" (9") Hemlock N.47 E. (N.46 E.) 27.5' (27.35') --- 10" Yellow Birch (now dead and down) S.25 E. (S.24 E.) 25.0' --- 12" (12") Hemlock (now a dead B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Corner recorded in Ontonagon County in USFS Liber, Page V-13 on 9/14/72.

Act 74 research form on file with Ontonagon County records.

Recovered the monument as described and the bearing trees as noted in parentheses above.

Shallow depressions are all that remain of the two original B.T.s. The witness tree recovered in 1935 and 1970 is now a 23" live Yellow Birch with GLO blaze. PEER GROUP APPROVED

COUNTY REVLESENTATIVE 07-08-96

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner: Additional bearing objects referenced:

> S.50 E. 6' Steel sign rail

S.50 E. 46.76' 12" Red Maple

14" Yellow Birch S.47 W. 21.62'

OF MICHIE RICHARD L. DRAHN LAND SURVEYOR No. 21564 PED LAND

Signed by _

Date June 17, 1996