SECTION

Recorded Plat

Lot No\_

## VAN BUREN COUNTY REMONUMENTATION LAND CORNER RECORDATION CERTIFICATE


DEC 16 12 00 PM 197.

For corners in VAN BUREN COUNTY	COLUMBIA TWP,	Corner ID # COMMON COR. SEC 7 8 17 18 T1S,R15W COLUMBIA TWP.		18	o Mark Co
Public Land Survey	T <u>1\$</u>	R <u>15W</u>	<u>C-5</u>		

5. Private Claims

I. Alan Bartlett in a field survey on November 25 1997 hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners; all in the same town and range, may be recorded on this certificate.

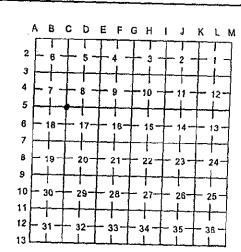

A. Description of original monument and accessories and/or subsequent restoration:

(SEE BACK OF PAGE)

Ratified by Peer Group in accordance with P.A. 345 of 1990 Yan Buren County Surveyor

Dote D. R. A. 12/16/97

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FOUND 1/2" IRON PIPE 10" BELOW SURFACE W/ NUB OUT @ CENTER LINE OF 56TH STREET AND 8TH AVENUE. VERIFIED CORNER USING EXISTING WITNESSES. THIS GOVERNMENT MONUMENT WAS RESTORED WITH APPROVAL OF THE VAN BUREN COUNTY REMONUMENTATION PEER GROUP OF SURVEYORS NOVEMBER 19, 1997.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

SET 3 1/2" HARRISON MONUMENT IN GRAVEL ROAD 1.3' BELOW SURFACE @ CENTER LINE OF 56TH STREET AND 8TH AVENUE.

WITNESSES

N80°E 44.54' CENTER LINE OF STOP SIGN
S36°E 45.11' CENTER LINE TELEPHONE RISER
S50°W 71.95' DBL HEADED NAIL IN SE SIDE OF P.P.
S75°W 49.35' CENTER LINE OF STOP SIGN
S51°W 46.59' FOUND CAPPED IRON #6523

Corner is accepted as a careful and faithful perpetuation of the position of the original corner



Signed by Surveyor's Michigan License No. 35988

Date 12/15/97

LIBER 5 PAGE 43

WITNESSES

MAPLE 8" \$65½°E 5 LINKS MAPLE 7" \$76½°W

13 LINKS

1972

W.Q. SMITH RLS # 6523 RECORDED SURVEY LIBER1 PAGE 310 FOUND PIPE 12" DEEP DROVE ROD IN CENTER TO SURFACE

WITNESSES

TACK AND WASHER IN ELY SIDE OF P.P.

SW 71.92'

CENTER LINE OF STREET SIGN POST 3"
TACK AND WASHER IN ELY SIDE OF P.P.

SW 32.391 SE 45.01'

4/21/1972

W.Q. SMITH RLS 36523 RECORDED SURVEY LIBER 1 PAGE 331 FOUND PIPE 12" DEEP DROVE ROD IN CENTER TO SURFACE WITNESSES SAME AS ABOVE

7/16/1976

W.Q. SMITH RLS #6523 RECORDED SURVEY LIBER 6 PAGE 88 FOUND PIPE 12" DEEP DROVE ROD IN CENTER TO SURFACE

WITNESSES SAME AS ABOVE

11/17/97

LANDMARK TECH. ALAN BARTLETT RLS #35988 FOUND ½" IRON PIPE 10" BELOW SURFACE WINUB OUT @ CENTER LINE OF 56TH ST AND 8TH AVE.

WITNESSES

N80°E 44.54

CENTER LINE STOP SIGN
CENTER LINE TELEPHONE RISER 45.11 S36°E DBL HEADED NAIL IN SE SIDE OF P.P.

71.95 S50°W S75°W S51°W 49.35 CENTER LINE OF STOP SIGN

46.59 FOUND CAPPED IRON #6523