

MAR 8 1 1993

COMM. 1993

RECEIVED

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

1993 DEC 29 AM 9:41

For corners in

Wexford
(County)

Located In:

Corner Code ##

Linda Longmiller
WEXFORD COUNTY, MI
REGISTERED OF DEEDS

1. Public Land Survey T 22N R 9W M-9
T _____ R _____
T _____ R _____
T _____ R _____
2. Property Controlling S _____ T _____ R _____
in Section S _____ T _____ R _____
3. Miscellaneous S _____ T _____ R _____
Property in Sec. S _____ T _____ R _____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Richard Wilcox, in a field survey on November 11, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- M-9) 1971 Roser survey in Section 24, recorded in Liber 2, page 989, also Liber 1, page 37M-9)1838 GLO Section corner by John Brink, Deputy Surveyor, Beech 9" S 15° W 66, Y. Pine 14" N 59° W 21
- M-9) 1853 GLO Section corner by John Brink, Deputy Surveyor, Y. Pine 18 S 87° E 9, Y. Pine 22 N 30° E 53, T22N, R8W
- M-9) 1905 Teed survey in Section 25: N. Pine 16" S 83 1/2° E 9 links, N. Pine 14" N 69° W 21 links (Gov.) Liber 1, page 148
- M-9) 1971 DNR survey in Section 24, Set DNR monument, Liber 2, page 989, also Liber 1, page 37, 22" Oak N 84° E 66.5', 22" Oak S 52° E 109.', 24" Oak site 132.00, Cedar post w/ loc. tag East 33'
- M-9) 1979 Wilcox survey in Section 25, recorded in Liber 1, page 609, DNR mon. East 22" Oak 66.5, S 17° E 24" Oak 132.0, S 52° E 22" Oak 109.5
- M-9) 1984 Ray survey in Section 24, recorded in Liber 2, page 120, DNR mon. East 22" Oak 66.5, S 17° E 24" Oak 132.00, S 57° E 22" Oak 109.50

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

A. - con't

- M-9) 1990 Ray survey in Section 24, Liber 69, page 664, DNR mon. in mon. box, N 65° E 8" R. Pine 56.10, N 80° E 24" Oak 68, S 20° E stop sign 48.95', S 50° W tele ped. 68.00'

B.


- M-9) Section corner common to Sections 24, 25 and 30, 19, T22N, R8W
Found DNR monument (broken) in monument box 0.5' North of centerline of road to the West and the centerline of a road to the South and ±9' East of centerline of road to the North. This corner is accepted as a careful and faithful perpetuation of the position of the original corner.

Peer Group Reviewed and Approved

Date: 11-29-93*Richard D. Wilcox*
Richard D. Wilcox, Wexford County Surveyor

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- M-9) Replaced with 5/8" x 36" Iron with Wexford Co. brass cap stamped: SE 24, PS 33989, 1993
N 85° E - 68.02 - 22" Oak
S 51° E - 110.67 - 22" Oak
S 11° E - 133.32 - 24" Oak
N 63° E - 56.14 - 8" Red Pine
N 85° E - 68.02 - 24" Oak

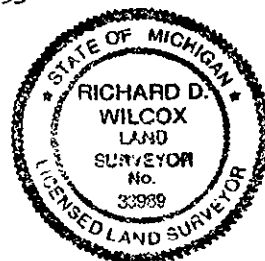

Signed by Richard D. Wilcox
Surveyor's Michigan License No. 33989

Date 11/29/93