

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY_____ T. 24 N. R. 10		H-7; H-8; H-9
2. PROPERTY CONTROLLING IN SECTION 22, T. 24 N. R. 10		7
3. MISCELLANEOUS PROPERTY IN SECTION_____, T._____, S., R._____, E. W.		
4. LOT NO._____, RECORDED PLAT_____		
5. PRIVATE CLAIMS_____		

REGISTER OF DEEDS STAMP AND
FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on August 18, 1976, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on_____, 19_____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~A. Description of original monument and accessories and of subsequent restorations:~~

C. (continued)

7
Drove 1 1/2"x18" Rod
14" Willow S72°E 57.10
10" Willow S27°E 79.60
Ctr. N-S b'top co. rd.
Due W 5'
Set cedar post w/loc. tag Due W 33'
Ctr. Silver Creek C-W Due N 36'

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- 1-7 Found well point (deep) that had been hit by grader. Straightened it up to fit old fence line to north.
- 1-8 Established at intersection of E-W 1/4 line with N-S 1/4 line. No occupancy at this position or nearby.
- 1-9 Found 2" pipe in concrete in E-W dirt road (Schaaf monument). Old pottery around monument.
- 7 Established 1/16 corner per standard B.L.M. instructions.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

H-7	H-8	H-9
Set 1 1/2"x20" rod over well pt.	Drove 1 1/2"x70" pipe; cedar post	Fd. 2" pipe in concrete
6" Cedar S23°E 48.50	w/loc. tag	7" R. Pine N34°W 37.20
6" Twn. Tamarack S37°W 56.46	6" Cedar N41°W 18.1	6" R. Pine N54°W 53.42
7" Maple N01°E 55.65	14" Cedar N33°E 34.6	3" Maple S57°W 48.15
Ctr. E-W blacktop county rd.	7" Cedar S79°E 28.8	Set cedar post w/loc. tag
Due N 3'	10" Cedar S18°E 23.1	Due N 33.0
	7" Cedar S68°W 26.6	Ctr. E-W dirt road
		Due N 2'

SIGNED BY

Carl F. Roser

DATE 10-31-77

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY


CHIEF OF SURVEY PARTY

DATE

APPROVED AND SIGNED BY

MICHIGAN REGISTERED LAND SURVEYOR

DATE

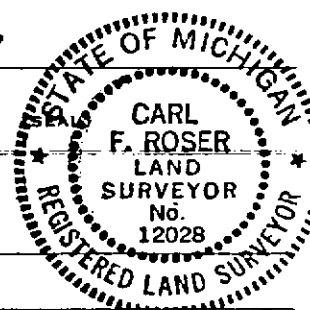

(SEAL)

GREENWOOD TOWNSHIP
WEXFORD COUNTY

SURVEYOR'S MICHIGAN REGISTRATION NO. _____