

APPROVED

DATE 11-20-96

CO. REP. 14

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich, P.A. 1970

RECORDED  
WASHTENAW COUNTY, MI  
PEGGY M. HAINES  
COUNTY CLERK/REGISTER

FEB 18 9 07 AM '97

RECORDED  
WASHTENAW COUNTY, MI

For corner in

Washtenaw  
(County)

Located in:

Corner Code #

1. Public Land Survey

T 2S R 6E

I-9

2. Property Controlling  
in Section

S

T

R

3. Miscellaneous  
Property in Sec

S

T

R

4. Lot No. , Recorded Plat

5. Private Claims

Liber 000001 Page 0593

Register of Deeds Stamp & File Number

I, Charles C. Wilson, in a field survey on November 1, 19 96,

do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instruction of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below.

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

United States Government Survey, 1815 Instructions, Surveyed 1819

Bearing Trees B. Oak 18" S74deg.E 23.10'

B. Oak 20" N69deg.W 26.40'

Meas. (S) 2640'

(E) 2601.72'

(W) 2590.5'

Continued on Back:

SURVEY &  
REMONUMENTATION

MAY 05 1997

COMMISSION

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 3/4" Iron Pipe 0.5' below Gravel Road Surface (Glacier Road) from information and accessories mentioned in Paragraph A. Removed 3/4" Iron Pipe but found no evidence of 2" Iron Pipe (1955).

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Re-Set 3/4" Iron Pipe with 1" x 24" Iron Pipe with Remonumentation Cap Stamped #13604

22" Stump N40deg.W 28.6' \*\*\*\*

14" Pine N15deg.E 39.85' (MDOT Tag) \*\*\*\*

12" Chinese Elm N30deg.E 23.24' (Nail & RT NW/S) \*

18" Cottonwood N80deg.E 72.68' (Nail & RT S/S)

10" Oak S80deg.E 95.90' (Nail & RT N/S)

Utility Pole S'ly 31.06' (Nail & RT W/S)

Water Valve N25deg.W 43.42' to center

\* Indicates accessory previously mentioned in Paragraph A

RT Indicates Remonumentation Tag

I believe this point should be accepted as the best available evidence of the position of the original corner.

This point was ratified by the Washtenaw County Peer Committee on November 20, 1996.

Signed by


Surveyors Michigan's License No.

13604

Date

November 21, 1996

COPY

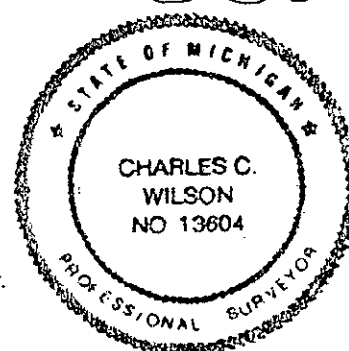

**Paragraph A Continued:**

Date Unknown  
Washtenaw County Road Commission Grid Book  
Found Iron Pipe  
18" Oak N40deg.W 28.60'  
10" Pine N15deg.E 39.85'

H.H. Atwell, PS #322, May 1926, December 1926, February 1950  
Survey Drawings

Atwell-Hicks, Inc., August 1955  
E.C. McKenzie  
Book 615, Page 62  
Found 2" Iron Pipe down 2', raised with 3/4" x 24" Iron Pipe and Stones  
12" B. Oak N40deg.W 28.7'  
12" Pine N10deg.E 39.9'  
2" B. Oak N10deg.W 38.5'  
Telephone Pole N50deg.W 64.8'

Atwell-Hicks, Inc., April 30, 1971  
John L. Snyder, PS #13352  
Previous Land Corner Recordation Certificate, Liber 1, Page 5  
Found Iron Pipe  
Accessories Same as August 1955

Washtenaw Engineering Co., Inc., February 13, 1979  
Norman N. Fahrner, PS #17620  
Previous Land Corner Recordation Certificate, Liber 5, Page 202  
Found 1/2" Iron Pipe  
18" Oak N40deg.W 28.60' (Nail)  
10" Pine N15deg.E 39.85' (Nail)  
Telephone Pole N55deg.W 64.73' (Nail)  
4" Juniper N5deg.E 22.59' (Nail)  
10" Chinese Elm N30deg.E 23.67' (Nail)

Plat of THE WOODLANDS, Liber 25, Pages 10-12, March 30, 1987

SURVEY &  
REMONI

MAY 05 1997

COMM. S. J.